



ERGOCUT A 101



CE EN60974-7

| CODE | ↔ | | |
|-----------------|-----|-------|--------------|
| PAA206M-000-BA3 | 6 m | 19.7' | 1/4 GAS |
| PAA206M-004-BA3 | 6 m | 19.7' | CENTRAL |
| PAA206M-082-BA3 | 6 m | 19.7' | M14x1 |
| PAA206M-304-BA3 | 6 m | 19.7' | TRAFIMECTOR® |

| TECHNICAL DATA | | |
|----------------|--------|---------|
| HF | | |
| 1m | 0,8 kg | 1,76 lb |
| V PEAK | 500 | |
| 5 bar | | |
| 180 l/min | | |
| X 60% | 100A | |
| X 100% | 75A | |
| 25÷30 mm | | |

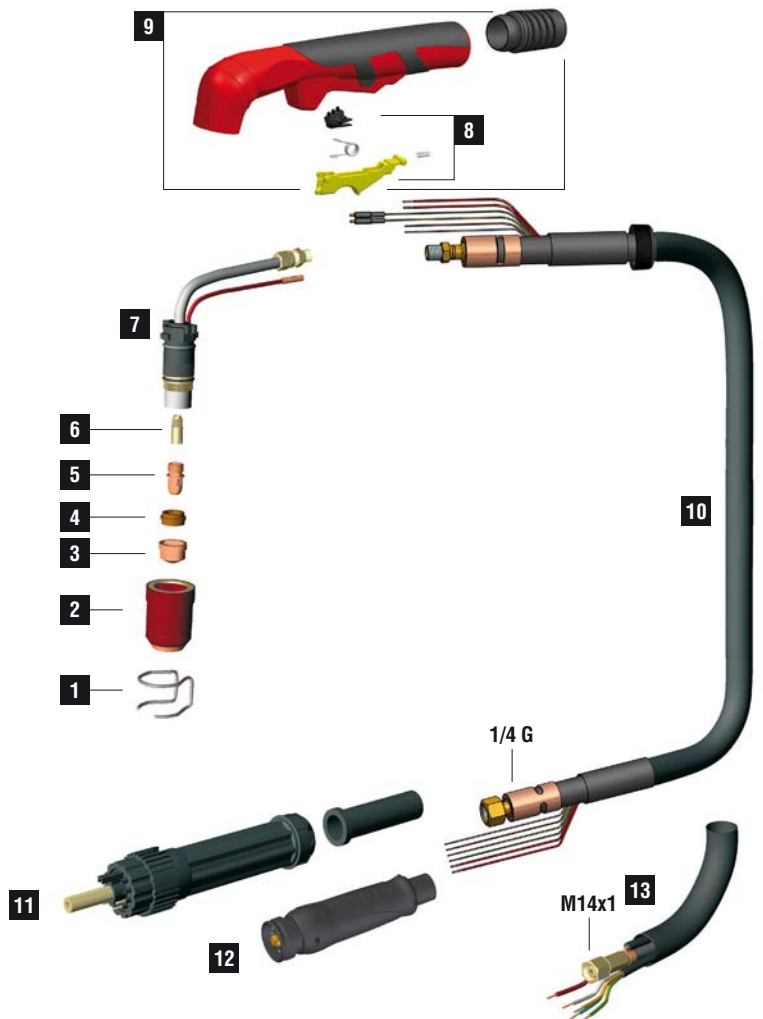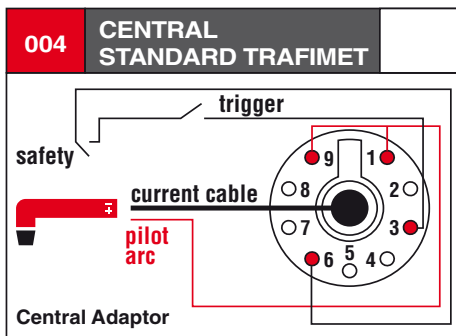

| | CODE | | Description | Ø | ↔ | CONTACT | | | | | DRAG | | GOUGING | REF | |
|---|-----------|--|------------------------|---------|---------|---------|---|---|---|---|------|---|---------|-------|----|
| | | | | | | | | | | | | | | | |
| 1 | CV0008 | | plasma stand off guide | | 32,5 mm | | | | | | | | | 51957 | 10 |
| 1 | CV0009 | | plasma stand off guide | | 38,6 mm | | | | | | | | | | 10 |
| 1 | CV0011 | | plasma stand off guide | | 23 mm | ● | | | | | | | | 1386 | 10 |
| 1 | CV0012 | | plasma stand off guide | | 30 mm | | ● | | | | | | | 1408 | 2 |
| 1 | CV0014 | | plasma stand off guide | | 30 mm | | | ● | | | | | | | 2 |
| 1 | CV0021 | | plasma stand off guide | 32,8 mm | 40,6 mm | | | | ● | | | | | | 1 |
| 1 | CV0023 | | plasma stand off guide | | 17,6 mm | | | | | | | | ● | | 10 |
| 1 | CV0039 | | plasma stand off guide | | 18,5 mm | | | | | | | | ● | | 2 |
| 2 | FH0297 | | for CV0039 CV0023 | | | | | | | | | | ● | | 10 |
| 2 | PC0109 | | | | 44,1 mm | ● | ● | ● | ● | | | | | | 2 |
| 2 | PC0111 | | | | 44,1 mm | ● | ● | ● | ● | | | | | | 2 |
| 2 | PC0113 | | | | 42,3 mm | | | | | ● | | ● | | | 2 |
| 2 | PC0130 | | long life | | 42,9 mm | | | | | | | | ● | | 2 |
| 3 | PD0101-08 | | 30 A | 0,8 mm | .030" | 13,7 mm | ● | ● | ● | ● | ● | | | - | 10 |
| 3 | PD0101-11 | | 60 A | 1,1 mm | .043" | 13,7 mm | ● | ● | ● | ● | ● | | | - | 10 |
| 3 | PD0101-14 | | 100 A | 1,4 mm | .052" | 13,7 mm | ● | ● | ● | ● | ● | | | - | 10 |
| 3 | PD0101-17 | | 130 A | 1,7 mm | .066" | 13,7 mm | ● | ● | ● | ● | ● | | | - | 10 |
| 3 | PD0101-19 | | 140 A | 1,9 mm | .074" | 13,7 mm | ● | ● | ● | ● | ● | | | - | 10 |
| 3 | PD0101-30 | | gouging | 3,0 mm | 1/8" | 13,7 mm | | | | | | | | ● | - |
| 3 | PD0111-12 | | 80 A | 1,2 mm | .045" | 35,8 mm | | | | | | | ● | - | 10 |
| 3 | PD0117-14 | | 100 A | 1,4 mm | .052" | 34,8 mm | | | | | | | ● | - | 10 |
| 3 | PD0117-17 | | 130 A | 1,7 mm | .066" | 34,8 mm | | | | | | | ● | - | 10 |
| 3 | PD0117-19 | | 140 A | 1,9 mm | .074" | 34,8 mm | | | | | | | ● | - | 10 |
| 4 | PE0101 | | plasma diffuser | | | | ● | ● | ● | ● | ● | | ● | - | 2 |
| 4 | PE0103 | | plasma diffuser | | | | ● | ● | ● | ● | ● | ● | ● | - | 2 |
| 5 | PR0101 | | plasma electrode | | 22 mm | | ● | ● | ● | ● | | | ● | | 10 |
| 5 | PR0116 | | plasma electrode | | 43,1 mm | | | | | | | | ● | | 10 |
| 6 | FH0562 | | | | | | ● | ● | ● | ● | ● | | ● | | 10 |

| CODE | |
|------|--|
|------|--|

| CODE | |
|------|--|
|------|--|

| | | | | |
|----|--------|--|-------------------|----|
| 7 | EA0131 | | O-ring | 10 |
| 7 | PF0145 | | plasma torch head | 1 |
| 8 | TP0400 | | kit trigger | 1 |
| 9 | TP0402 | | handle kit | 1 |
| 10 | PH4108 | | 6 m - 1/4 G | 1 |

| | | | | |
|----|--------|--|-----------------|---|
| 11 | CY0002 | | cable support | 1 |
| 11 | FY0023 | | central adaptor | 1 |
| 12 | FY0090 | | TRAFIMECTOR® | 1 |
| 13 | PH4163 | | 6 m - M14X1 | 1 |

STANDARD

CONTACT SHORT

CONTACT LONG

DRAG SHORT

DRAG LONG